


# Gantry images

wl\_dir/WL G=0, C=0, P=0;  
Field=(40, 40)mm; BB=4mm @  
left=0, in=0, up=0; Gantry  
tilt=1, Gantry sag=0.dcm


CAX to BB: 0.90mm  
X: 0.00mm; Y: 0.90mm

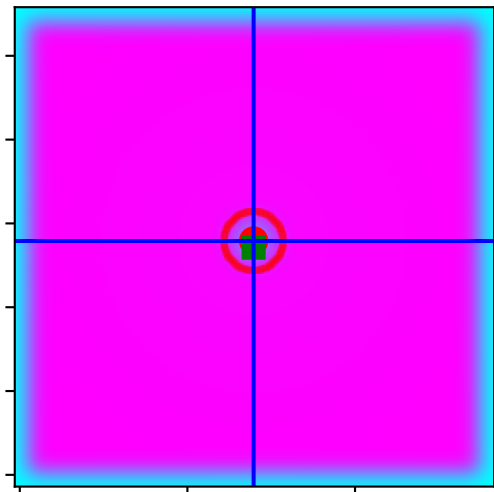

G=0, B=0, P=0

wl\_dir/WL G=90, C=0, P=0;  
Field=(40, 40)mm; BB=4mm @  
left=0, in=0, up=0; Gantry  
tilt=1, Gantry sag=0.dcm


CAX to BB: 0.00mm  
X: 0.00mm; Y: 0.00mm

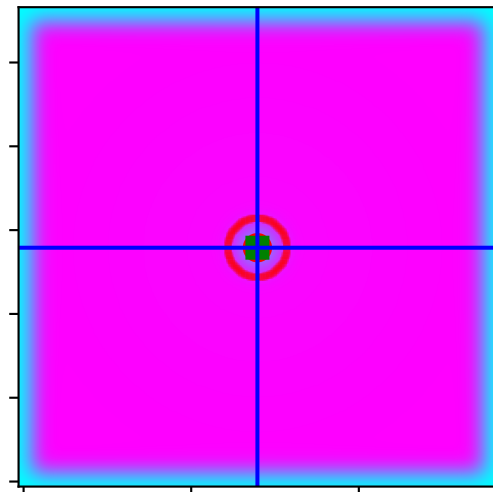

G=90, B=0, P=0

wl\_dir/WL G=180, C=0, P=0;  
Field=(40, 40)mm; BB=4mm @  
left=0, in=0, up=0; Gantry  
tilt=1, Gantry sag=0.dcm


CAX to BB: 0.90mm  
X: 0.00mm; Y: -0.90mm

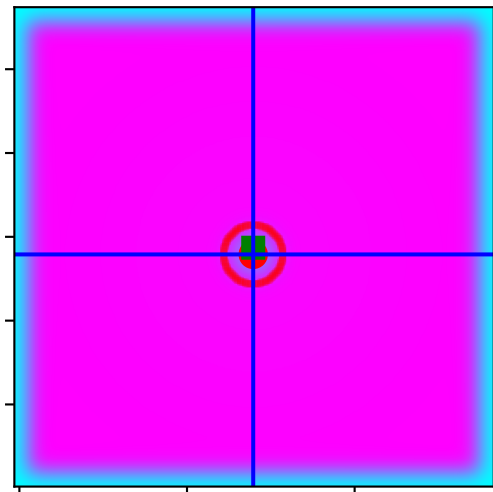

G=180, B=0, P=0

wl\_dir/WL G=270, C=0, P=0;  
Field=(40, 40)mm; BB=4mm @  
left=0, in=0, up=0; Gantry  
tilt=1, Gantry sag=0.dcm

CAX to BB: 0.00mm  
X: 0.00mm; Y: 0.00mm

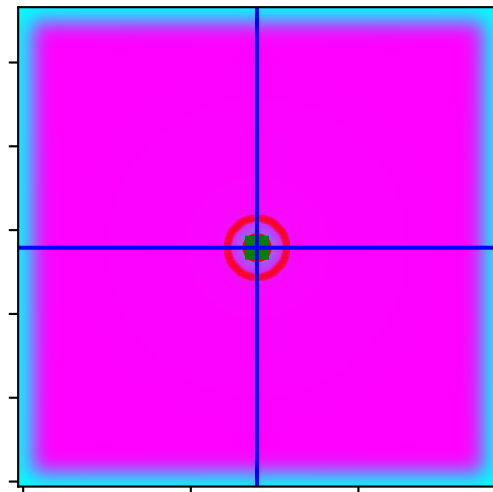

G=270, B=0, P=0